

RSD

TENUTA STELO TIPO RSD

Descrizione

La guarnizione tipo RSD è molto simile al tipo RSC ma sul lato dinamico, ossia sul diametro interno, presenta due labbri che hanno più di una funzione:

- attenua eventuali fenomeni di stick-slip grazie al fluido trattenuto nell'intercapedine fra i due labbri
- evita alle impurità di entrare dall'esterno
- contrasta il ritiro del materiale alle basse temperature
- funge da stabilizzatore.

Dati tecnici

Pressione:	‹ 400 bar a temperatura di 60° C
Velocità:	‹ 0.5 m/s
Temperatura:	da - 35° C a + 100° C con punte fino a 110° C
Fluidi:	fluidi e oli minerali (v. tabella 3 a p. 14)

Materiale

Il materiale proposto è il poliuretano tipo Co ad alto modulo elastico, basso compression-set, alta resistenza all'abrasione.
Ha una durezza di 93 Shore A ± 2.
Codice materiale: Co

Montaggio

Eliminare bave e spigoli taglienti nella sede e sullo stelo per evitare che le guarnizioni si danneggino durante il montaggio. È consigliabile lubrificare la tenuta durante il montaggio per agevolare l'inserimento dello stelo.
Per ulteriori informazioni leggere le istruzioni a p. 63.

RSD TYPE ROD SEAL

Description

The RSD seal type is similar to the RSC type, but on the dynamic side, it presents a multifunctional double lip which:

- *reduces stick-slip effects thanks because it keeps oil between the secondary lip and the main one*
- *stops any external impurities*
- *faces the material shrinkage at low temperatures*
- *acts as a stabilizer.*

Technical data

Pressure:	*‹ 400 bar at a temperature of 60° C*
Speed:	*‹ 0.5 m/s*
Temperature:	*from - 35° C to + 100° C with peaks till 110° C*
Fluids:	*mineral fluids and oils (see table 3, page 14)*


Material


The proposed material is a "Co" type polyurethane, with high elasticity modulus, low compression-set and high abrasion resistance.
The hardness is 93 Shore A ± 2.
Compound reference: Co

Assembling

To prevent any damage to the seal, remove any flash and cutting edges in the housing and on the rod.
The seal should always be lubricated before assembling in order to have easier insertion of the rod.
For further information please refer to the installation instructions on page 63.

RSD

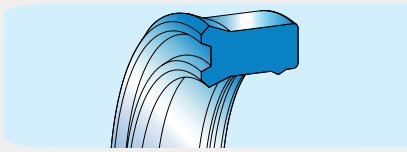


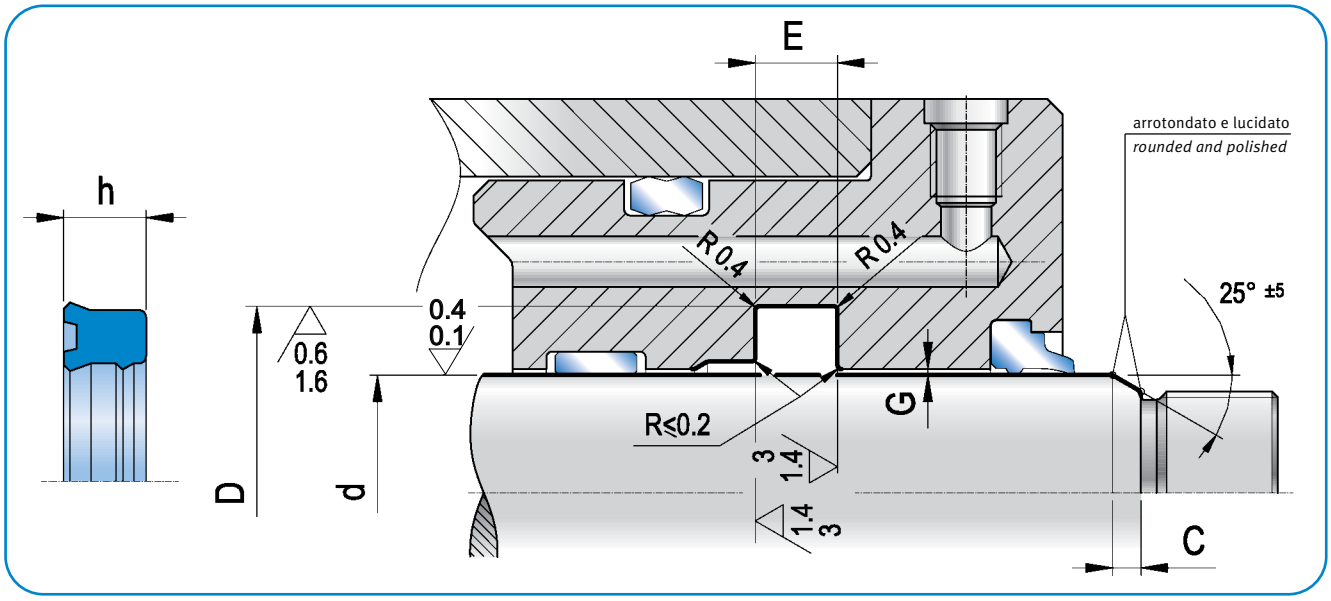

	d_{h9}	D_{H10}	h	$E_{+0,2}$	C	ART / *ITEM*
*	6,0	14,0	5,8	6,3	3,5	RSD 0060 0140 058 Co
*	8,0	14,0	5,7	6,3	3,5	RSD 0080 0140 057 Co
*	8,0	16,0	5,8	6,3	3,5	RSD 0080 0160 058 Co
*	10,0	18,0	5,8	6,3	3,5	RSD 0100 0180 058 Co
	11,0	16,0	3,5	4,0	3,5	RSD 0110 0160 035 Co
	12,0	19,0	5,0	5,6	3,5	RSD 0120 0190 050 Co
*	12,0	20,0	5,8	6,3	4,5	RSD 0120 0200 058 Co
	14,0	21,0	5,0	5,6	4,0	RSD 0140 0210 050 Co
	14,0	22,0	5,8	6,3	4,5	RSD 0140 0220 058 Co
	15,0	21,0	4,5	5,0	4,0	RSD 0150 0210 045 Co
	15,0	23,0	5,8	6,3	4,5	RSD 0150 0230 058 Co
	15,0	23,0	6,0	7,0	4,5	RSD 0150 0230 060 Co
	16,0	22,0	5,0	5,6	3,5	RSD 0160 0220 050 Co
*	16,0	24,0	5,8	6,3	4,5	RSD 0160 0240 058 Co
	18,0	22,0	4,0	4,5	3,0	RSD 0180 0220 040 Co
	18,0	24,0	4,7	5,3	4,0	RSD 0180 0240 047 Co
	18,0	25,0	5,0	5,7	4,0	RSD 0180 0250 050 Co
*	18,0	26,0	5,8	6,3	4,5	RSD 0180 0260 058 Co
	18,0	26,0	8,0	9,0	4,5	RSD 0180 0260 080 Co
	20,0	25,0	4,0	4,5	3,5	RSD 0200 0250 040 Co
	20,0	26,0	3,2	4,0	3,5	RSD 0200 0260 032 Co

	d_{h9}	D_{H10}	h	$E_{+0,2}$	C	ART / *ITEM*
	20,0	26,0	5,2	6,0	3,5	RSD 0200 0260 052 Co
*	20,0	28,0	5,8	6,3	4,5	RSD 0200 0280 058 Co
*	20,0	30,0	7,0	8,0	5,0	RSD 0200 0300 070 Co
	22,0	28,0	4,5	5,5	3,5	RSD 0220 0280 045 Co
	22,0	28,0	5,8	6,3	3,5	RSD 0220 0280 058 Co
	22,0	29,0	5,0	5,6	4,0	RSD 0220 0290 050 Co
*	22,0	30,0	5,8	6,3	4,5	RSD 0220 0300 058 Co
	24,0	32,0	5,8	6,3	4,5	RSD 0240 0320 058 Co
	25,0	31,0	5,0	5,6	3,5	RSD 0250 0310 050 Co
	25,0	31,0	3,5	4,0	3,5	RSD 0250 0310 035 Co
	25,0	32,0	4,0	4,5	3,5	RSD 0250 0320 040 Co
*	25,0	33,0	5,8	6,3	4,5	RSD 0250 0330 058 Co
	25,0	33,0	6,5	7,5	4,5	RSD 0250 0330 065 Co
	25,0	33,0	7,0	8,0	4,5	RSD 0250 0330 070 Co
	25,0	33,0	8,0	9,0	4,5	RSD 0250 0330 080 Co
*	25,0	35,0	7,0	8,0	5,0	RSD 0250 0350 070 Co
	25,0	35,0	8,0	9,0	5,0	RSD 0250 0350 080 Co
	26,0	34,0	5,8	6,3	5,0	RSD 0260 0340 058 Co
*	28,0	34,0	3,5	4,0	4,5	RSD 0280 0340 035 Co
*	28,0	36,0	5,8	6,3	4,5	RSD 0280 0360 058 Co
*	28,0	38,0	5,8	6,3	5,0	RSD 0280 0380 058 Co

* in conformità alle norme ISO/DIN 5597 e ISO 5597/1 – in *accordance with ISO/DIN 5597 and ISO 5597/1 norms*

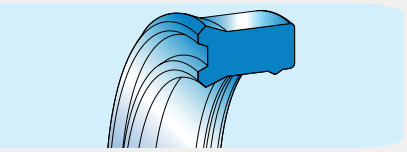


RSD

	d_{h9}	D_{H10}	h	$E_{+0,2}$	C	ART / *ITEM*
*	28,0	38,0	7,0	8,0	5,0	RSD 0280 0380 070 Co
	30,0	38,0	5,8	6,3	4,5	RSD 0300 0380 058 Co
	30,0	38,0	7,0	8,0	4,5	RSD 0300 0380 070 Co
	30,0	38,0	8,0	9,0	4,5	RSD 0300 0380 080 Co
	30,0	40,0	6,5	7,5	5,0	RSD 0300 0400 065 Co
	30,0	40,0	10,0	11,0	5,0	RSD 0300 0400 100 Co
	32,0	40,0	5,8	6,3	4,5	RSD 0320 0400 058 Co
	32,0	40,0	6,0	7,0	4,5	RSD 0320 0400 060 Co
	32,0	40,0	8,0	9,0	4,5	RSD 0320 0400 080 Co
*	32,0	42,0	7,0	8,0	4,5	RSD 0320 0420 070 Co
	32,0	42,0	8,0	9,0	5,0	RSD 0320 0420 080 Co
	32,0	42,0	10,0	11,0	5,0	RSD 0320 0420 100 Co
	32,0	45,0	8,0	9,0	7,0	RSD 0320 0450 080 Co
	35,0	43,0	5,8	6,3	4,5	RSD 0350 0430 058 Co
	35,0	43,0	6,0	7,0	4,5	RSD 0350 0430 060 Co
	35,0	43,0	8,0	9,0	4,5	RSD 0350 0430 080 Co
	35,0	45,0	7,0	8,0	5,0	RSD 0350 0450 070 Co
	35,0	45,0	10,0	11,0	5,0	RSD 0350 0450 100 Co
*	36,0	44,0	5,8	6,3	4,5	RSD 0360 0440 058 Co
	36,0	44,0	8,0	9,0	4,5	RSD 0360 0440 080 Co
	40,0	48,0	5,8	6,3	4,5	RSD 0400 0480 058 Co
	40,0	48,0	8,0	9,0	4,5	RSD 0400 0480 080 Co
*	40,0	50,0	7,0	8,0	5,0	RSD 0400 0500 070 Co
	40,0	50,0	10,0	11,0	5,0	RSD 0400 0500 100 Co
	40,0	55,0	10,0	11,0	6,5	RSD 0400 0550 100 Co
	42,0	50,0	6,0	7,0	4,5	RSD 0420 0500 060 Co
	42,0	52,0	8,0	9,0	5,0	RSD 0420 0520 080 Co
	45,0	52,0	12,0	13,0	5,0	RSD 0450 0520 120 Co
*	45,0	53,0	5,8	6,3	4,5	RSD 0450 0530 058 Co
	45,0	53,0	8,0	9,0	4,5	RSD 0450 0530 080 Co
	45,0	53,0	10,0	11,0	4,5	RSD 0450 0530 100 Co
*	45,0	55,0	5,7	6,3	5,0	RSD 0450 0550 057 Co
*	45,0	55,0	7,0	8,0	5,0	RSD 0450 0550 070 Co
	45,0	55,0	10,0	11,0	5,0	RSD 0450 0550 100 Co
	46,0	54,0	8,0	9,0	4,5	RSD 0460 0540 080 Co
	50,0	58,0	8,0	9,0	4,5	RSD 0500 0580 080 Co
	50,0	58,0	11,5	12,5	4,5	RSD 0500 0580 115 Co
*	50,0	60,0	7,0	8,0	5,0	RSD 0500 0600 070 Co
	50,0	60,0	9,0	10,0	5,0	RSD 0500 0600 090 Co
	50,0	60,0	10,0	11,0	5,0	RSD 0500 0600 100 Co
	50,0	65,0	8,0	9,0	6,5	RSD 0500 0650 080 Co
	50,0	65,0	10,0	11,0	6,5	RSD 0500 0650 100 Co
	55,0	63,0	8,0	9,0	4,5	RSD 0550 0630 080 Co
	55,0	65,0	7,0	8,0	5,0	RSD 0550 0650 070 Co
	55,0	65,0	10,0	11,0	5,0	RSD 0550 0650 100 Co
	55,0	65,0	12,0	13,0	5,0	RSD 0550 0650 120 Co
	56,0	64,0	8,0	9,0	4,5	RSD 0560 0640 080 Co
	56,0	66,0	6,5	7,5	5,0	RSD 0560 0660 065 Co
	56,0	66,0	7,3	8,0	5,0	RSD 0560 0660 073 Co
*	56,0	71,0	11,5	12,5	6,5	RSD 0560 0710 115 Co
	60,0	68,0	6,3	7,0	4,5	RSD 0600 0680 063 Co
	60,0	68,0	8,0	9,0	4,5	RSD 0600 0680 080 Co
	60,0	68,0	13,0	14,0	4,5	RSD 0600 0680 130 Co
	60,0	70,0	7,0	8,0	5,5	RSD 0600 0700 070 Co
	60,0	70,0	7,5	8,5	5,5	RSD 0600 0700 075 Co
	60,0	70,0	10,0	11,0	5,5	RSD 0600 0700 100 Co
	60,0	70,0	12,0	13,0	5,5	RSD 0600 0700 120 Co
	60,0	72,0	9,0	10,0	6,0	RSD 0600 0720 090 Co
	61,0	69,0	8,0	9,0	4,5	RSD 0610 0690 080 Co
	63,0	71,0	8,0	9,0	4,5	RSD 0630 0710 080 Co
	65,0	73,0	8,0	9,0	4,5	RSD 0650 0730 080 Co
	65,0	75,0	12,0	13,0	5,0	RSD 0650 0750 120 Co
	65,0	77,0	9,0	10,0	6,0	RSD 0650 0770 090 Co
	65,0	80,0	10,5	11,5	6,0	RSD 0650 0800 105 Co
	68,0	76,0	8,0	9,0	4,5	RSD 0680 0760 080 Co
	70,0	78,0	8,0	9,0	4,5	RSD 0700 0780 080 Co
*	70,0	80,0	6,5	7,5	5,5	RSD 0700 0800 065 Co
	70,0	80,0	7,0	8,0	5,0	RSD 0700 0800 070 Co
	70,0	80,0	12,0	13,0	5,5	RSD 0700 0800 120 Co
	70,0	82,0	9,5	10,5	6,0	RSD 0700 0820 095 Co
*	70,0	85,0	11,5	12,5	6,5	RSD 0700 0850 115 Co
	75,0	83,0	6,3	7,0	4,5	RSD 0750 0830 063 Co
	75,0	83,0	8,0	9,0	4,5	RSD 0750 0830 080 Co
	75,0	85,0	7,0	8,0	5,5	RSD 0750 0850 070 Co
	75,0	85,0	12,0	13,0	5,5	RSD 0750 0850 120 Co
	76,0	84,0	8,0	9,0	4,5	RSD 0760 0840 080 Co
	76,0	86,0	8,0	9,0	5,0	RSD 0760 0860 080 Co
	78,0	86,0	8,0	9,0	4,5	RSD 0780 0860 080 Co

* in conformità alle norme ISO/DIN 5597 e ISO 5597/1 – in *accordance with ISO/DIN 5597 and ISO 5597/1 norms*

RSD

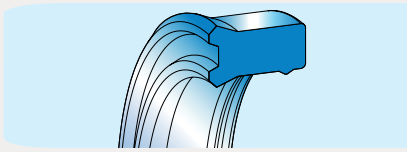

	d_{h9}	D_{H10}	h	$E_{+0,2}$	C	ART / *ITEM*
	78,0	86,0	13,0	14,0	4,5	RSD 0780 0860 130 Co
	80,0	88,0	8,0	9,0	4,5	RSD 0800 0880 080 Co
	80,0	90,0	12,0	13,0	5,0	RSD 0800 0900 120 Co
	80,0	92,0	9,0	10,0	6,0	RSD 0800 0920 090 Co
*	80,0	95,0	11,5	12,5	6,5	RSD 0800 0950 115 Co
	85,0	93,0	8,0	9,0	4,5	RSD 0850 0930 080 Co
	85,0	95,0	12,0	13,0	5,5	RSD 0850 0950 120 Co
	90,0	98,0	6,3	7,0	4,5	RSD 0900 0980 063 Co
	90,0	98,0	8,0	9,0	4,5	RSD 0900 0980 080 Co
*	90,0	100,0	6,5	7,5	5,5	RSD 0900 1000 065 Co
*	90,0	105,0	11,5	12,5	6,5	RSD 0900 1050 115 Co
	91,0	99,0	8,0	9,0	4,5	RSD 0910 0990 080 Co
	95,0	103,0	8,0	9,0	4,5	RSD 0950 1030 080 Co
	97,0	105,0	13,0	14,0	4,5	RSD 0970 1050 130 Co
	100,0	108,0	6,5	7,5	4,5	RSD 1000 1080 065 Co
	100,0	108,0	8,0	9,0	4,5	RSD 1000 1080 080 Co
	105,0	113,0	8,0	9,0	4,5	RSD 1050 1130 080 Co
	107,0	115,0	8,0	9,0	4,5	RSD 1070 1150 080 Co

	d_{h9}	D_{H10}	h	$E_{+0,2}$	C	ART / *ITEM*
	108,0	116,0	8,0	9,0	4,5	RSD 1080 1160 080 Co
*	110,0	125,0	9,5	10,5	6,5	RSD 1100 1250 095 Co
	110,0	125,0	11,0	12,0	6,5	RSD 1100 1250 110 Co
	115,0	123,0	8,0	9,0	4,5	RSD 1150 1230 080 Co
	115,0	130,0	11,3	12,0	6,5	RSD 1150 1300 113 Co
	120,0	128,0	11,5	12,5	4,5	RSD 1200 1280 115 Co
	120,0	135,0	15,0	16,0	6,5	RSD 1200 1350 150 Co
	125,0	133,0	7,5	8,5	4,5	RSD 1250 1330 075 Co
	125,0	133,0	8,0	9,0	4,5	RSD 1250 1330 080 Co
	126,0	134,0	8,0	9,0	4,5	RSD 1260 1340 080 Co
	130,0	145,0	15,0	16,0	6,5	RSD 1300 1450 150 Co
	135,0	143,0	8,0	9,0	4,5	RSD 1350 1430 080 Co
	135,0	150,0	11,5	12,5	6,5	RSD 1350 1500 115 Co
	140,0	150,0	11,5	12,5	5,0	RSD 1400 1500 115 Co
	145,0	153,0	8,0	9,0	4,5	RSD 1450 1530 080 Co

* in conformità alle norme ISO/DIN 5597 e ISO 5597/1 – in *accordance with ISO/DIN 5597 and ISO 5597/1 norms*

Nota: altre dimensioni non a catalogo a richiesta. Consultare il nostro ufficio tecnico.

Remark: please contact our technical dept. for further dimensions not included in the catalogue.